



(TRANSMISSION)

Sept 2004

FORD 5R55N, 5R55W
UPDATE

Our advisory board has pointed out a significant problem with 5R55N, and 5R55W units. The 4 - 3 Pre-Stroke Intermediate Band Control Valve Spring may break due to the spring being machined incorrectly. They also point out, a code P0795 (Pressure Control Solenoid C circuit failure or shortage) may be present as well.

These springs are not available in bulk from OE and until now builder had to buy the entire Valve body to solve this problem. Precision International has added this spring (PI part number 53799C / Sub kit K-53799C) to our kits for these units. Kit numbers K53900N and K53900W with date codes of 04261 and later will contain the spring.

Please contact your Precision International distributor or sales representative for more information.